


Male Run Tee

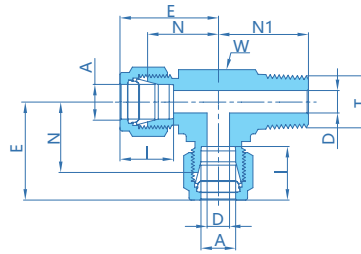

TUBE (METRIC)

Ordering Information	A Tube O.D.		T (NPT)		D		W Wrench Flat		N		E		N1		I	
	mm	inch	mm	inch	mm	inch	mm	inch	mm	inch	mm	inch	mm	inch	mm	inch
SS-VMRT-6M-M2	6	1/8	4.8	1/2	12.7	19.6	27.0	18.8	15.3							
SS-VMRT-6M-M4	6	1/4	4.8	1/2	12.7	19.6	27.0	23.4	15.3							
SS-VMRT-8M-M2	8	1/8	4.8	5/8	15.9	22.4	29.9	20.8	16.2							
SS-VMRT-8M-M4	8	1/4	6.4	5/8	15.9	22.4	29.9	25.4	16.2							
SS-VMRT-10M-M4	10	1/4	7.1	13/16	20.6	25.9	33.5	28.2	17.2							
SS-VMRT-12M-M4	12	1/4	7.1	13/16	20.6	25.9	36.0	28.2	22.8							
SS-VMRT-12M-M6	12	3/8	9.5	13/16	20.6	25.9	36.0	28.2	22.8							
SS-VMRT-12M-M8	12	1/2	9.5	13/16	20.6	25.9	36.0	33.0	22.8							
SS-VMRT-16M-M8	16	1/2	11.9	15/16	23.8	27.9	38.0	35.0	24.4							

TUBE (INCH)


Ordering Information	A Tube O.D.		T (NPT)		D		W Wrench Flat		N		E		N1		I	
	inch	mm	inch	mm	inch	mm	inch	mm	inch	mm	inch	mm	inch	mm	inch	mm
SS-VMRT-02-M2	1/8	3.17	1/8	.09	2.28	7/16	11.1	.67	17.02	.93	23.62	.70	17.78	.50	12.7	
SS-VMRT-02-M4	1/8	3.17	1/4	.09	2.28	1/2	12.7	.71	18.03	.97	24.64	.92	23.40	.50	12.7	
SS-VMRT-03-M2	3/16	4.76	1/8	.12	3.05	7/16	11.1	.70	17.78	.96	24.38	.70	17.78	.54	13.7	
SS-VMRT-04-M2	1/4	6.35	1/8	.19	4.82	1/2	12.7	.77	19.56	1.06	26.92	.74	18.8	.60	15.2	
SS-VMRT-04-M4	1/4	6.35	1/4	.19	4.82	1/2	12.7	.77	19.56	1.06	26.92	.92	23.37	.60	15.2	
SS-VMRT-05-M2	5/16	7.93	1/8	.19	4.82	5/8	15.9	.88	22.35	1.17	29.71	.82	20.83	.64	16.2	
SS-VMRT-06-M4	3/8	9.52	1/4	.28	7.11	5/8	15.9	.91	23.11	1.20	30.48	1.00	25.40	.66	16.8	
SS-VMRT-06-M6	3/8	9.52	3/8	.28	7.11	13/16	20.6	1.02	25.91	1.31	33.27	1.11	28.19	.66	16.8	
SS-VMRT-08-M6	1/2	12.70	3/8	.38	9.5	13/16	20.6	1.02	25.91	1.42	36.07	1.11	28.19	.90	22.9	
SS-VMRT-08-M8	1/2	12.70	1/2	.41	10.41	13/16	20.6	1.02	25.91	1.42	36.07	1.30	33.00	.90	22.9	
SS-VMRT-10-M8	5/8	15.87	1/2	.47	11.94	15/16	23.8	1.10	27.94	1.50	38.1	1.38	35.05	.96	24.4	
SS-VMRT-12-M12	3/4	19.05	3/4	.62	15.75	1-1/16	27.0	1.17	29.72	1.57	39.88	1.45	36.83	.96	24.4	



Dimensions are for reference only and are subject to change without prior notice




Male Run Tee POS

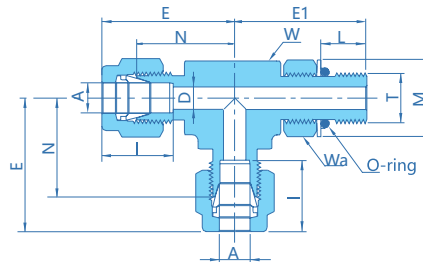

TUBE (INCH) TO SAE / MS STRAIGHT THREAD BOSS (POSITIONABLE)

Ordering Information	A Tube O.D.		T (SAE/MS)		D		W Wrench Flat		Wa Hex. Flat		N		E		E1		L		M		I	
	inch	mm	inch	mm	inch	mm	inch	mm	inch	mm	inch	mm	inch	mm	inch	mm	inch	mm	inch	mm	inch	mm
SS-VMRT-04-A4	1/4	6.35	7/16-20	.19	4.8	1/2	12.7	9/16	.83	21.10	1.12	28.45	1.12	28.45	.39	9.9	.65	16.5	.60	15.2		
SS-VMRT-06-A6	3/8	9.52	9/16-18	.28	7.1	5/8	15.9	11/16	.97	24.64	1.26	32.00	1.27	32.26	.44	11.2	.79	20.1	.66	16.8		

Male Run Tee POS

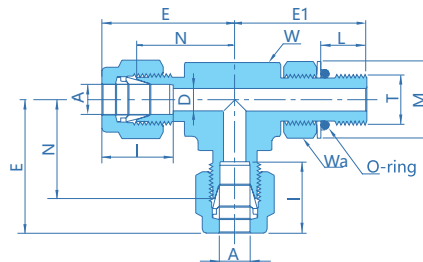

TUBE (METRIC) TO ISO PARALLEL THREAD (POSITIONABLE)

Ordering Information	A Tube O.D.		T (ISO)		D		W Wrench Flat		Wa Hex. Flat		N		E		E1		L		M		I	
	mm	inch	mm	inch	mm	inch	mm	mm	inch	mm	mm	mm	mm	mm	mm	mm	mm	mm	mm	mm	mm	mm
SS-VMRT-6M-G2	6	G-1/8	4.0	1/2	12.7	9/16	19.6	27.0	26.4	8.1	17.3	15.3										
SS-VMRT-6M-G4	6	G-1/4	4.8	5/8	15.9	3/4	21.6	29.0	32.2	9.1	22.9	15.3										
SS-VMRT-8M-G4	8	G-1/4	5.9	5/8	15.9	3/4	22.4	29.9	32.2	9.1	22.9	16.2										
SS-VMRT-10M-G4	10	G-1/4	5.9	15/16	23.8	3/4	25.9	33.5	35.0	9.1	22.9	17.2										


TUBE (INCH) TO ISO PARALLEL THREAD (POSITIONABLE)

Ordering Information	A Tube O.D.		T (ISO)		D		W Wrench Flat		Wa Hex. Flat		N		E		E1		L		M		I	
	inch	mm	inch	mm	inch	mm	inch	mm	inch	mm	inch	mm	inch	mm	inch	mm	inch	mm	inch	mm	inch	mm
SS-VMRT-04-G2	1/4	6.35	G-1/8	.16	4.0	1/2	12.7	9/16	.77	19.6	1.06	26.9	1.04	26.4	.32	8.1	.68	17.3	.60	15.2		
SS-VMRT-04-G4	1/4	6.35	G-1/4	.19	4.8	5/8	15.9	3/4	.85	21.6	1.14	28.9	1.27	29.0	.36	9.1	.90	22.9	.60	15.2		
SS-VMRT-06-G4	3/8	9.52	G-1/4	.23	5.9	5/8	15.9	3/4	.91	23.1	1.20	30.5	1.27	30.5	.36	9.1	.90	22.9	.66	16.8		

* When ordering code SS-VMRT-**-AG**, "AG" stands for combined gaskets.




Male Branch Tee POS

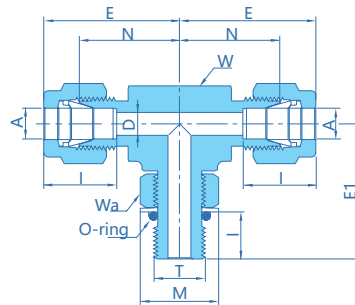

TUBE (INCH) TO SAE / MS STRAIGHT THREAD BOSS (POSITIONABLE)

Ordering Information	A Tube O.D.		T (SAE)		D		W Wrench Flat		Wa Hex. Flat		N		E		E1		L		M		I	
	inch	mm	inch	mm	inch	mm	inch	mm	inch	mm	inch	mm	inch	mm	inch	mm	inch	mm	inch	mm	inch	mm
SS-VMBT-04-A4	1/4	6.35	7/16-20	.19	4.8	1/2	12.7	9/16	.83	21.10	1.12	28.45	1.12	28.45	.39	9.9	.65	16.5	.60	15.2		
SS-VMBT-06-A6	3/8	9.52	9/16-18	.28	7.1	5/8	15.9	11/16	.97	24.64	1.26	32.00	1.27	32.26	.44	11.2	.79	20.1	.66	16.8		

Male Branch Tee POS

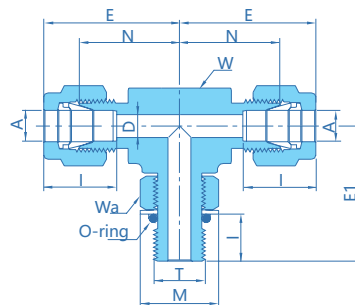

TUBE (METRIC) TO ISO PARALLEL THREAD (POSITIONABLE)

Ordering Information	A Tube O.D.		T (ISO)		D		W Wrench Flat		Wa Hex. Flat		N		E		E1		L		M		I	
	mm	inch	mm	inch	mm	inch	mm	inch	mm	inch	mm	mm	mm	mm	mm	mm	mm	mm	mm	mm	mm	mm
SS-VMRT-6M-G2	6	G-1/8	4.0	1/2	12.7	9/16	19.6	27.0	26.4	8.1	17.3	15.3										
SS-VMRT-6M-G4	6	G-1/4	4.8	5/8	15.9	3/4	21.6	29.0	32.2	9.1	22.9	15.3										
SS-VMRT-8M-G4	8	G-1/4	5.9	5/8	15.9	3/4	22.4	29.9	32.2	9.1	22.9	16.2										
SS-VMRT-10M-G4	10	G-1/4	5.9	15/16	23.8	3/4	25.9	33.5	35.0	9.1	22.9	17.2										

TUBE (INCH) TO ISO PARALLEL THREAD (POSITIONABLE)

Ordering Information	A Tube O.D.		T (ISO)		D		W Wrench Flat		Wa Hex. Flat		N		E		E1		L		M		I	
	inch	mm	inch	mm	inch	mm	inch	mm	inch	mm	inch	mm	inch	mm	inch	mm	inch	mm	inch	mm	inch	mm
SS-VMRT-04-G2	1/4	6.35	G-1/8	.16	4.0	1/2	12.7	9/16	.77	19.6	1.06	26.9	1.04	26.4	.32	8.1	.68	17.3	.60	15.2		
SS-VMRT-04-G4	1/4	6.35	G-1/4	.19	4.8	5/8	15.9	3/4	.85	21.6	1.14	28.9	1.27	32.2	.36	9.1	.90	22.9	.60	15.2		
SS-VMRT-06-G4	3/8	9.52	G-1/4	.23	5.9	5/8	15.9	3/4	.91	23.1	1.20	30.5	1.27	32.2	.36	9.1	.90	22.9	.66	16.8		

* When ordering code SS-VMRT-**-AG**, "AG" stands for combined gaskets.

